

25th March 2022

Reference No. SMS1.21414-L22.Rev0

Mr. David Rowe
AR Contracting Services
649 Port Road
WOODVILLE PARK SA 5011

LOT 162 GOODENIA GROVE – CLOVER PARK LAND DIVISION STAGE 7, MOUNT BARKER

Dear David,

SMS Geotechnical Pty Ltd (SMS) was commissioned by AR Contracting Services to provide Level 1 earthworks inspection and testing services during fill placement on Lot 162 Goodenia Grove, Mount Barker. The area where fill was placed is shown approximately in Drawing SMS1.21414-F22.Rev0.

SMS were provided with a TBM by AR Contracting Services which was used to measure and record both pre and post fill levels. Post fill levels were taken prior to the placement of topsoil. The post fill levels were measured at approximately the same locations as the pre fill levels. These levels are detailed in Drawing SMS1.21414-F22.Rev0.

Whilst the utmost amount of care was taken while measuring these levels, SMS is not a licensed surveyor and the difference in measurements on Drawing SMS1.21414-F22.Rev0 may differ slightly to the maximum depth of placed fill on this site.

Level 1 inspection and testing services were carried out by SMS to Australian Standard AS3798-2007 "Guidelines on earthworks for commercial and residential developments" between 17th August 2021 and 9th December 2021. The subgrade was inspected and showed no signs of organic or unsuitable material. Subgrade proof rolling was witnessed prior to fill being placed and was deemed suitable by SMS' representative on site.

SMS conducted in situ density testing to AS1289.5.8.1 at randomly selected locations throughout areas in which fill was placed as per frequencies outlined in AS3798-2007. The density test results have been issued separately to AR Contracting Services and are retained in our project file. The required laboratory dry density ratio was achieved on all tests taken during fill placement. Laboratory tests were conducted to AS1289.5.1.1.

On the completion of Level 1 earthworks inspection and testing, SMS advise that the fill placed on Lot 162 Goodenia Grove as shown in Drawing SMS1.21414-F22.Rev0, was witnessed and in our opinion meets the requirements of "Controlled Fill" as defined in AS3798-2007 and AS2870-2011 "Residential slabs and footings".

However, it should be recognised that the passage of time affects the information provided in this letter. SMS's opinions are based upon information that existed at the time that our services were provided. The services allowed SMS to form no more than an opinion of the fill placement undertaken under our Level 1 inspection and testing services at the times the earthworks were carried out. These services cannot be used to assess the effect of any subsequent further works at the site.

If you have any questions relating to this project or require any additional information, please contact our office on (08) 8258 7498.


SMS GEOTECHNICAL PTY LTD



Luke Garcia
Business Development Manager


Attachments: Drawing SMS1.21414-F22.Rev0

Lot	Pre Fill	Post Fill
162	360.515	361.010

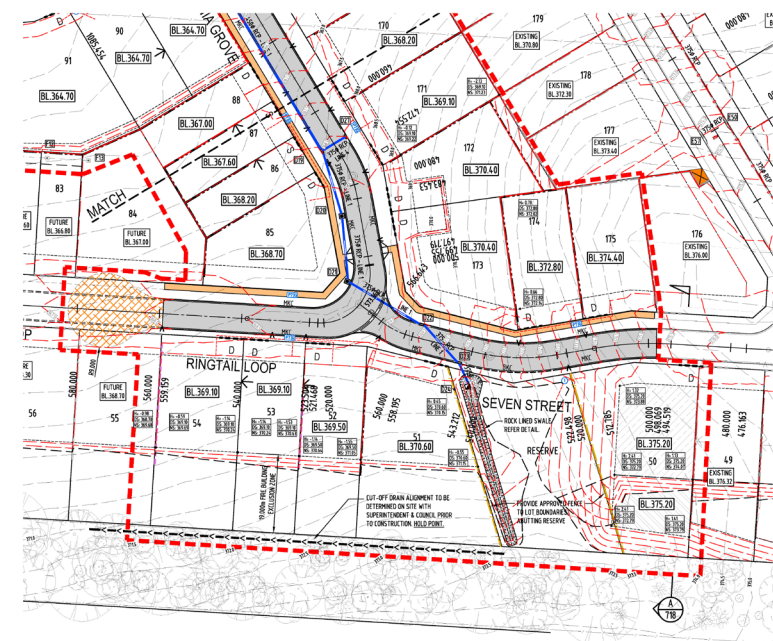

- LEGEND:

- | | | | |
|--|---|--|--|
| | EXISTING CONTOURS | | SLEEPER STAINING WALL |
| | DESIGN CONTOURS (50mm INTERVALS) | | SLEEPER STAINING WALL - WITH FENCE |
| | CUT & FILL DEPTH AND
DESIGN SLOPE LEVEL (80%
NATURAL SLOPE LEVEL (90%)) | | SLEEPER STAINING WALL - BY OTHER |
| | DESIGN LEVEL
E.G. GRATE INLET
E. INSET | | SLEEPER STAINING WALL - EXISTING |
| | DESIGN LEVEL
E.G. GRATE INLET
E. INSET | | SLEEPER STAINING WALL - FUTURE |
| | LIT BENCH LEVEL | | FENCE |
| | DESIGN SLOPE LEVEL | | TO BE REMOVED |
| | STORMWATER PIPE - REP PIPE | | TREE WITH TREE PROTECTION ZONE |
| | STORMWATER PIPE - UPVC PIPE | | TRANSFORMER/STANCHION CABLE EASE |
| | FUTURE STORMWATER PIPE | | LEVEL 1 - CARPARKS
(60% NON-SEALING MATERIAL) |
| | STORMWATER DRAINAGE PIT NUMBER | | LEVEL 1 - FILL
(STOCKPILE > 10% FILLING UNITS) |
| | CONCRETE FOOTPATH WITH KERB RAMP | | ROCK PILES |
| | SEE ENTRY PIT (DIP) | | TREE SENSITIVE BATTER CONSTRUCTION
REFER B.14.4 |
| | JUNCTION BOX (JB) | | |
| | ALLOTMENT STORMWATER CONNECTION | | |
| | FIELD DAILY FILL | | |
| | DRAINAGE OUTLET KERM HEIGHT | | |



REV	DATE	DESCRIPTION	DRAFT	ENG	C
A	15.03.21	FOR CLIENT REVIEW	VC	JB	
B	17.05.21	TENDER ISSUE	VC	JB	
C	6.08.21	COUNCIL APPROVAL	HJ	JB	

WGA
WALLBRIDGE GILBERT
AZTEC

60 Wyatt Street, Adelaide
South Australia 5000
Telephone 08 8223 7433
Email adelaide@wga.com.au

CLOVER PARK - STAGE 7			
FLAXLEY ROAD, MOUNT BARKER			
CLOVER PARK PROPERTY HOLDINGS			
ROADS & STORMWATER PLAN			
A1		DRAWING NUMBER	
		Job Number	Sheet No.
Design	Drawn	AD1161322	703
MAJOR	MAJOR		



Approx. Fill Location

SMS
GEOTECHNICAL
Quality in Construction

Drawn:	LG	Date:	24.03.2022
Checked:	DM	Date:	24.03.2022
Revision:		Date:	
Scale:	NTS		A4

**AR CONTRACTING SERVICES
CLOVER PARK STAGE 7
MOUNT BARKER
SITE PLAN SHOWING PRE AND POST FILL LEVELS**

Project No.: SMS1.21414	Drawing No.: SMS1.21414-F22.Rev0
--------------------------------	---