

25th March 2022

Reference No. SMS1.21414-L28.Rev0

Mr. David Rowe
AR Contracting Services
649 Port Road
WOODVILLE PARK SA 5011

LOT 169 GOODENIA GROVE – CLOVER PARK LAND DIVISION STAGE 7, MOUNT BARKER

Dear David,

SMS Geotechnical Pty Ltd (SMS) was commissioned by AR Contracting Services to provide Level 1 earthworks inspection and testing services during fill placement on Lot 169 Goodenia Grove, Mount Barker. The area where fill was placed is shown approximately in Drawing SMS1.21414-F28.Rev0.

SMS were provided with a TBM by AR Contracting Services which was used to measure and record both pre and post fill levels. Post fill levels were taken prior to the placement of topsoil. The post fill levels were measured at approximately the same locations as the pre fill levels. These levels are detailed in Drawing SMS1.21414-F28.Rev0.

Whilst the utmost amount of care was taken while measuring these levels, SMS is not a licensed surveyor and the difference in measurements on Drawing SMS1.21414-F28.Rev0 may differ slightly to the maximum depth of placed fill on this site.

Level 1 inspection and testing services were carried out by SMS to Australian Standard AS3798-2007 "Guidelines on earthworks for commercial and residential developments" between 17th August 2021 and 9th December 2021. The subgrade was inspected and showed no signs of organic or unsuitable material. Subgrade proof rolling was witnessed prior to fill being placed and was deemed suitable by SMS' representative on site.

SMS conducted in situ density testing to AS1289.5.8.1 at randomly selected locations throughout areas in which fill was placed as per frequencies outlined in AS3798-2007. The density test results have been issued separately to AR Contracting Services and are retained in our project file. The required laboratory dry density ratio was achieved on all tests taken during fill placement. Laboratory tests were conducted to AS1289.5.1.1.

On the completion of Level 1 earthworks inspection and testing, SMS advise that the fill placed on Lot 169 Goodenia Grove as shown in Drawing SMS1.21414-F28.Rev0, was witnessed and in our opinion meets the requirements of "Controlled Fill" as defined in AS3798-2007 and AS2870-2011 "Residential slabs and footings".

However, it should be recognised that the passage of time affects the information provided in this letter. SMS's opinions are based upon information that existed at the time that our services were provided. The services allowed SMS to form no more than an opinion of the fill placement undertaken under our Level 1 inspection and testing services at the times the earthworks were carried out. These services cannot be used to assess the effect of any subsequent further works at the site.

If you have any questions relating to this project or require any additional information, please contact our office on (08) 8258 7498.


SMS GEOTECHNICAL PTY LTD




Luke Garcia
Business Development Manager

Attachments: Drawing SMS1.21414-F28.Rev0

Lot	Pre Fill	Post Fill
169	365.720	366.670

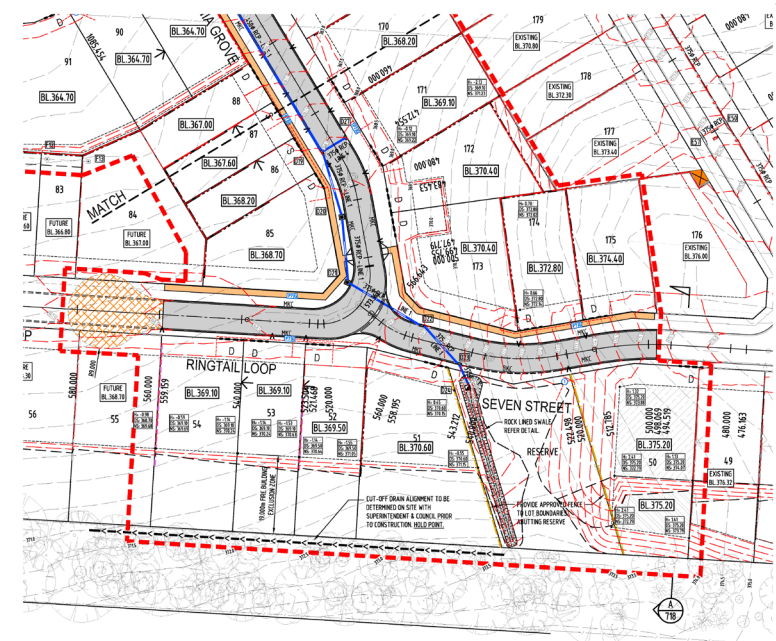

- LEGEND:**
- EXISTING CONTOURS
 - DESIGN CONTOURS (20mm INTERVALS)
 - CUTS/LIFTS/DEPTH OR DESIGN SURFACE LEVEL (BS)
 - NATURAL SURFACE LEVEL (MS)
 - DESIGN LEVELS
 - G - GRADE INLET
 - R - INVERT
 - LIFT BENCH LEVEL
 - DESIGN SURFACE LEVEL
 - STORMWATER PIPE - RCP PIPE
 - STORMWATER PIPE - UPVC PIPE
 - FUTURE STORMWATER PIPE
 - STORMWATER DRAINAGE PIT NUMBER
 - CONCRETE FOOTPATH WITH KERB RAMP
 - SIDE ENTRY PIT (SEP)
 - ANALOGUE BOX (B)
 - ALIGNMENT STORMWATER CONNECTION
 - FIELD Gully (F)
 - DRAINAGE OUTLET KERB INSERT
 - SLEEPER RETAINING WALL
 - SLEEPER RETAINING WALL - WITH FENCE
 - SLEEPER RETAINING WALL - BY OTHERS
 - SLEEPER RETAINING WALL - EXISTING
 - SLEEPER RETAINING WALL - FUTURE
 - FENCE
 - TREE TO BE REMOVED
 - TREE WITH TREE PROTECTION ZONE
 - TRANSFORMER/SWITCHING CUBICLE EASEMENT
 - LEVEL 1 - EARTHWORKS (SITE WORK CUT/FILL MATERIALS)
 - LEVEL 1 - FILL (STOCKPILE NO. 2 MATERIAL ONLY)
 - ROCK PITCHING
 - TREE SENSITIVE BATTERY CONSTRUCTION REFER DETAIL



TENDER ISSUE	REV	DATE	DESCRIPTION	DRAWN	ENG	CHKD
	A	10.03.21	FOR CLIENT REVIEW	VC	JB	
	B	11.03.21	TENDER ISSUE	VC	JB	
	C	08.03.21	COUNCIL APPROVAL	MJ	JB	
WGA WALLBRIDGE GILBERT AZTEC 60 Wynd Street, Adelaide South Australia 5000 Telephone 08 8223 7433 Email: wga@wga.com.au						
CLOVER PARK - STAGE 7 FLAXLEY ROAD, MOUNT BARKER CLOVER PARK PROPERTY HOLDINGS ROADS & STORMWATER PLAN A1 DRAWING NUMBER ADL161322 703						



Approx. Fill Location

SMS
GEOTECHNICAL
Quality in Construction

Drawn:	LG	Date:	24.03.2022
Checked:	DM	Date:	24.03.2022
Revision:		Date:	
Scale:	NTS		

A4

Project No.: SMS1.21414		Drawing No.: SMS1.21414-F28.Rev0	
-------------------------	--	----------------------------------	--

AR CONTRACTING SERVICES
CLOVER PARK STAGE 7
MOUNT BARKER
SITE PLAN SHOWING PRE AND POST FILL LEVELS